

PROGRAM UNIT:  
 PROGRAM MANAGEMENT TEAM 2




Date: -- Revision: --

Date: 02/03/2020 Submissions: 50% Submission  
 03/06/2020 90% Submission

**NEW YORK CITY HOUSING AUTHORITY  
 DESIGN DEPARTMENT**  
 24-02 49th Avenue, Long Island City, NY 11101  
 Tel 718-707-7771 Fax (call)

Development: Parkside Houses  
 Bldg. Addresses: See T001  
 Building No.: See T001  
 Borough of: Bronx  
 Oracle No.: 8143

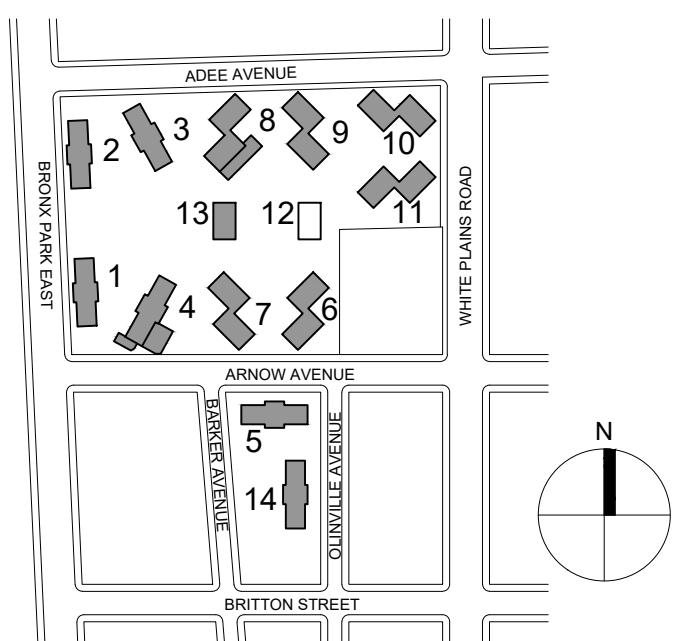

**Key/ Location Plan**  
 Zoning Map: 3c Zone: R7-1  
 Block No.: 4542 & 4507 Lot No.: 100 & 48  
 Development No.: NY0052678 E.D.P No.: 580



Contract Title:  
**MASONRY REPAIRS**

Contract No.: --

Drawing Title: Restoration Detail  
 CON 100 (2 OF 2)


Seal / Signature: Issue Date: 03.06.2020  
 Scale: AS NOTED  
 Drawn By: AC/AF/SR  
 Checked By: DE/DS  
 Drawing No.: **A502.00**  
 Sheet 052 of 058

DOB BSCAN STICKER

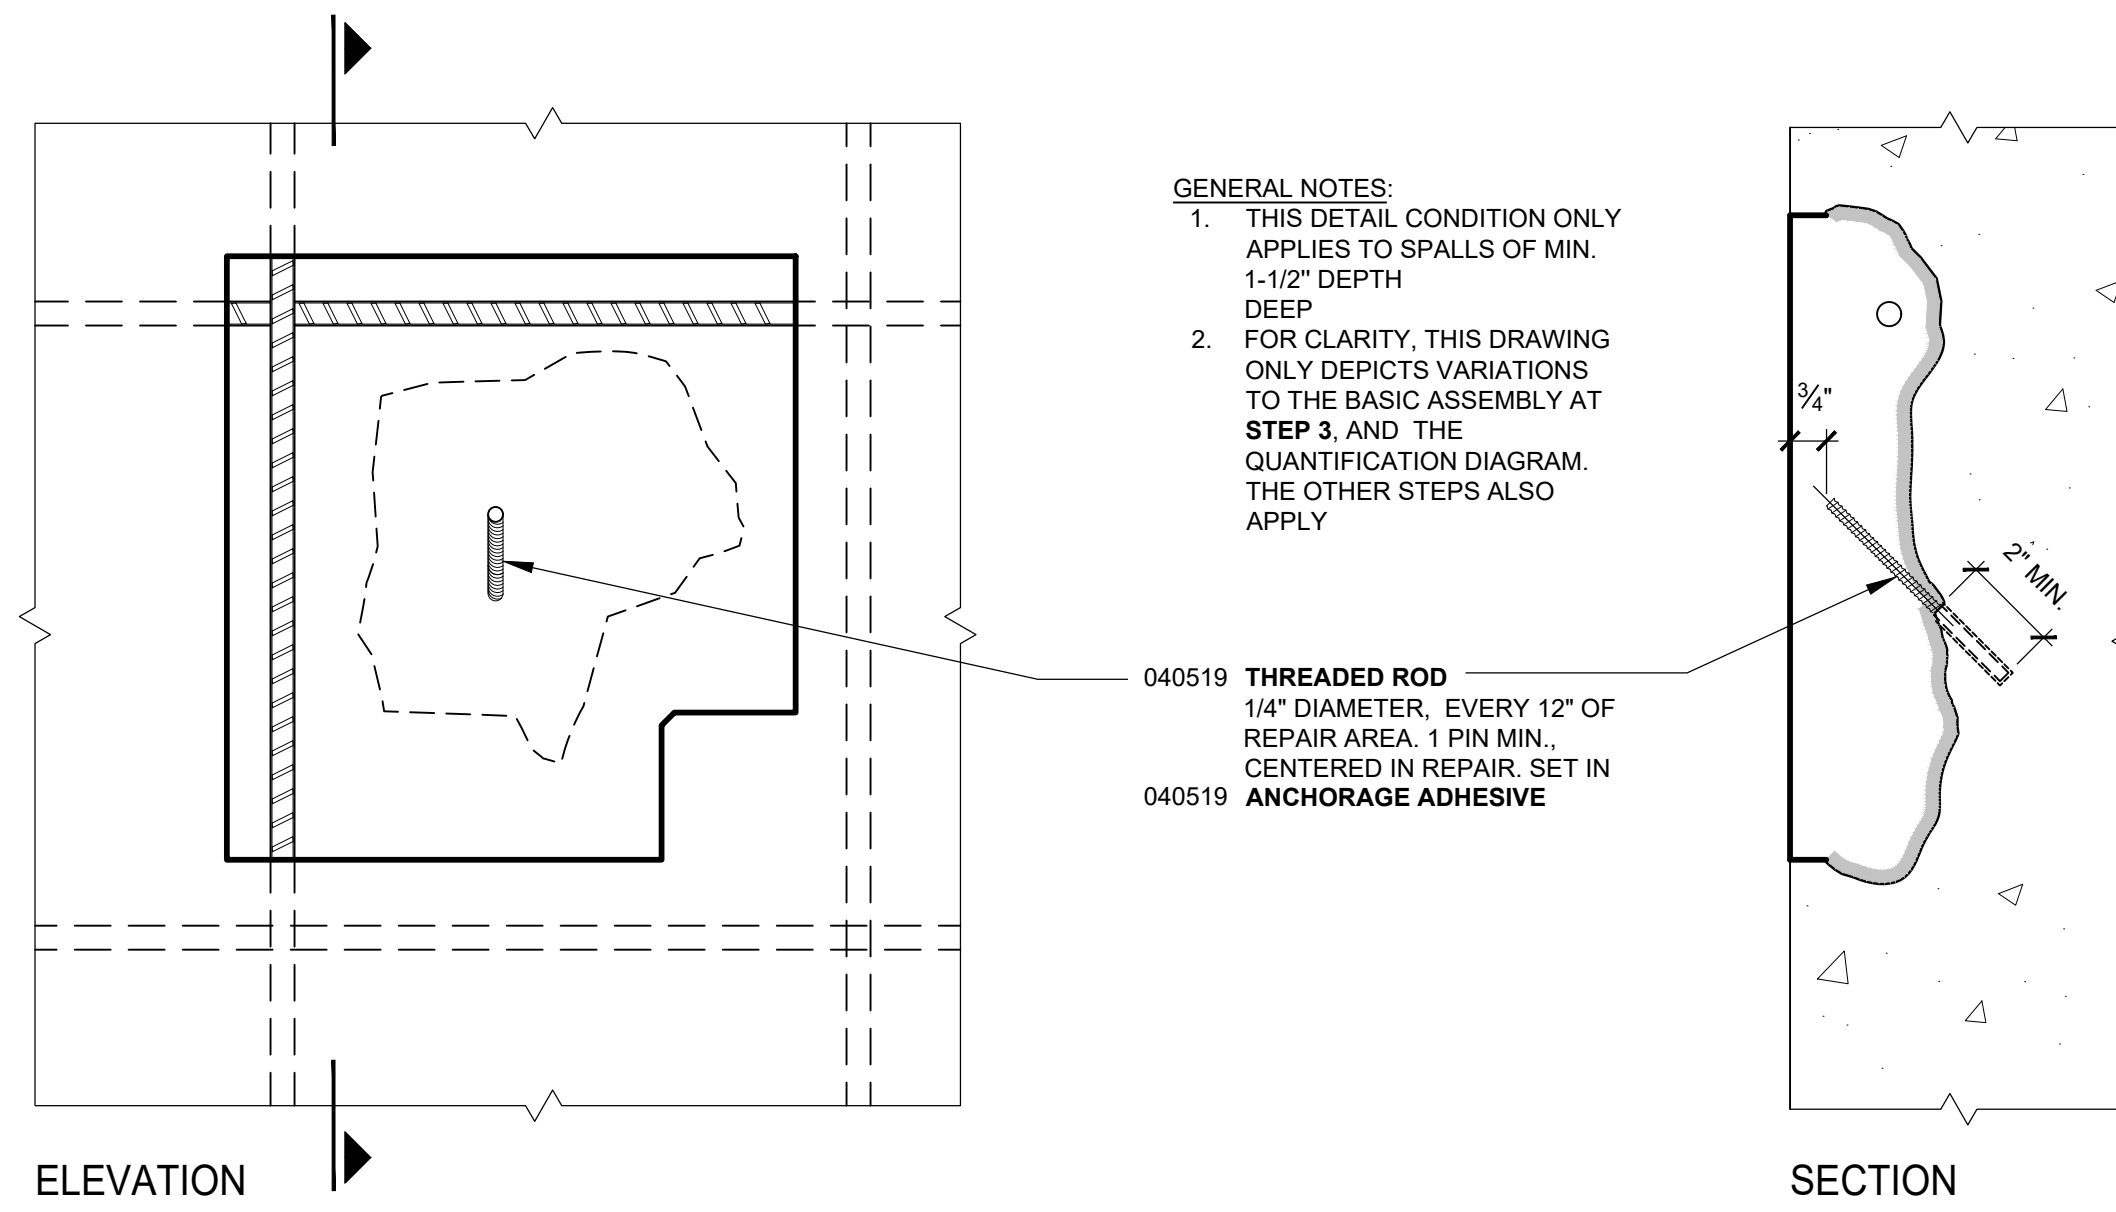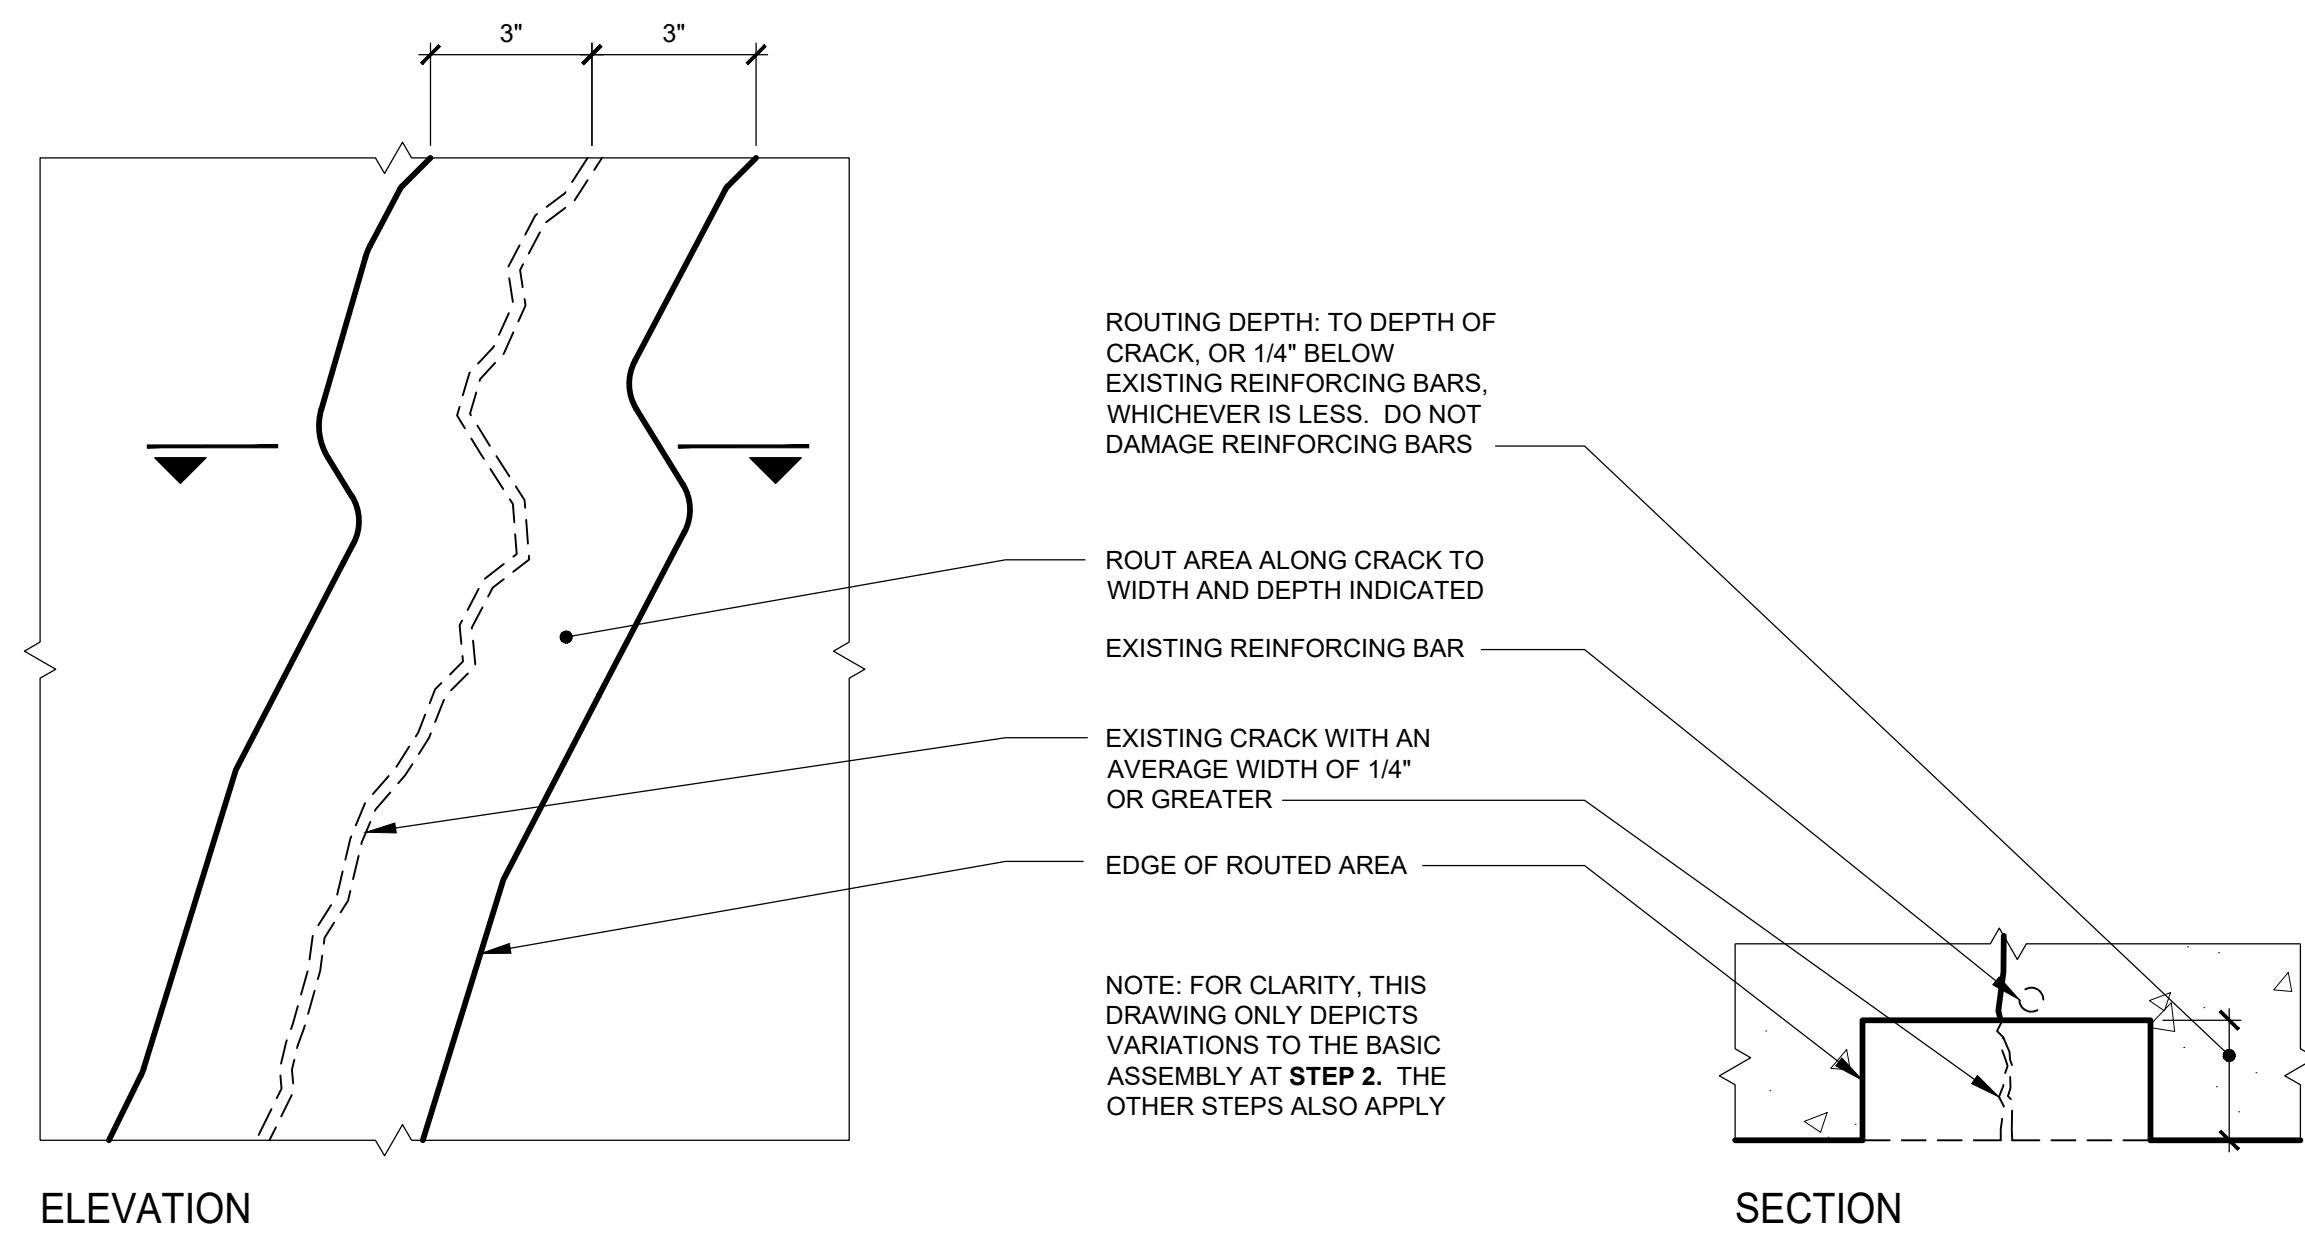


**@ CRACK > 1/4" WIDE**

NTS

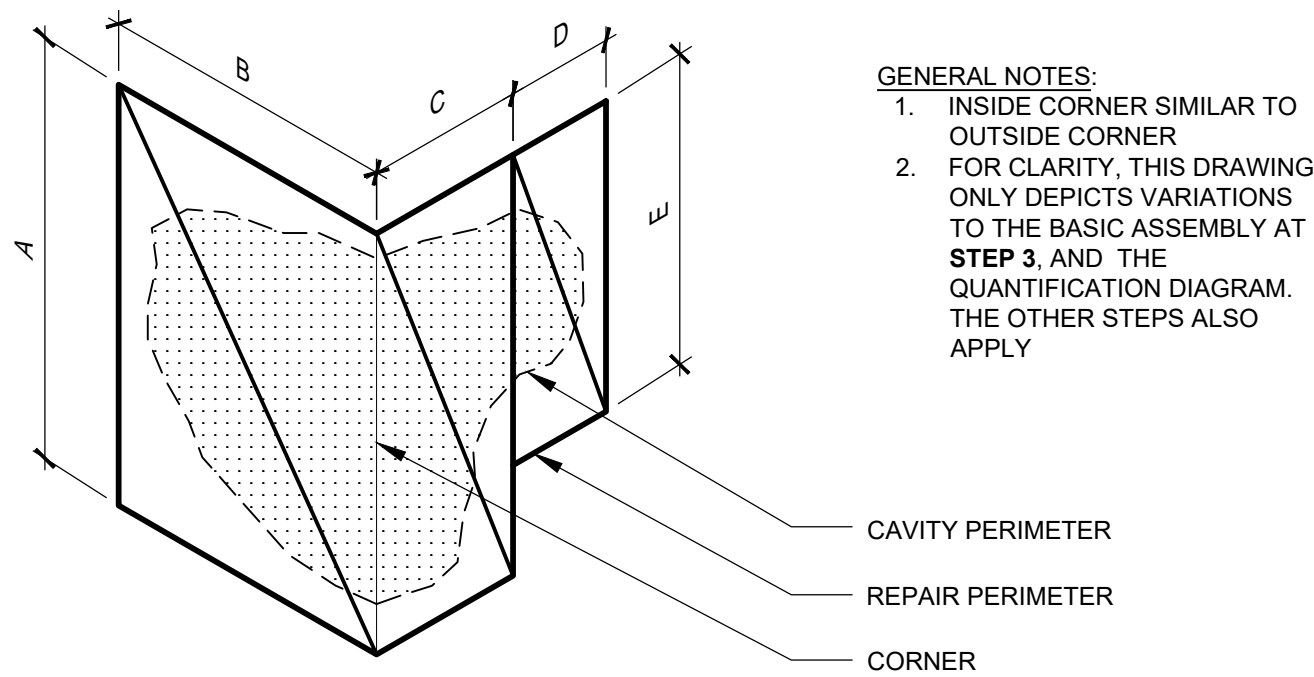


THE QUANTITY OF CONCRETE SPALL REPAIR, IS EQUAL TO THE TOTAL SURFACE AREA: (A x B) + (A x C) + (E x D)

**QUANTIFICATION DIAGRAM**

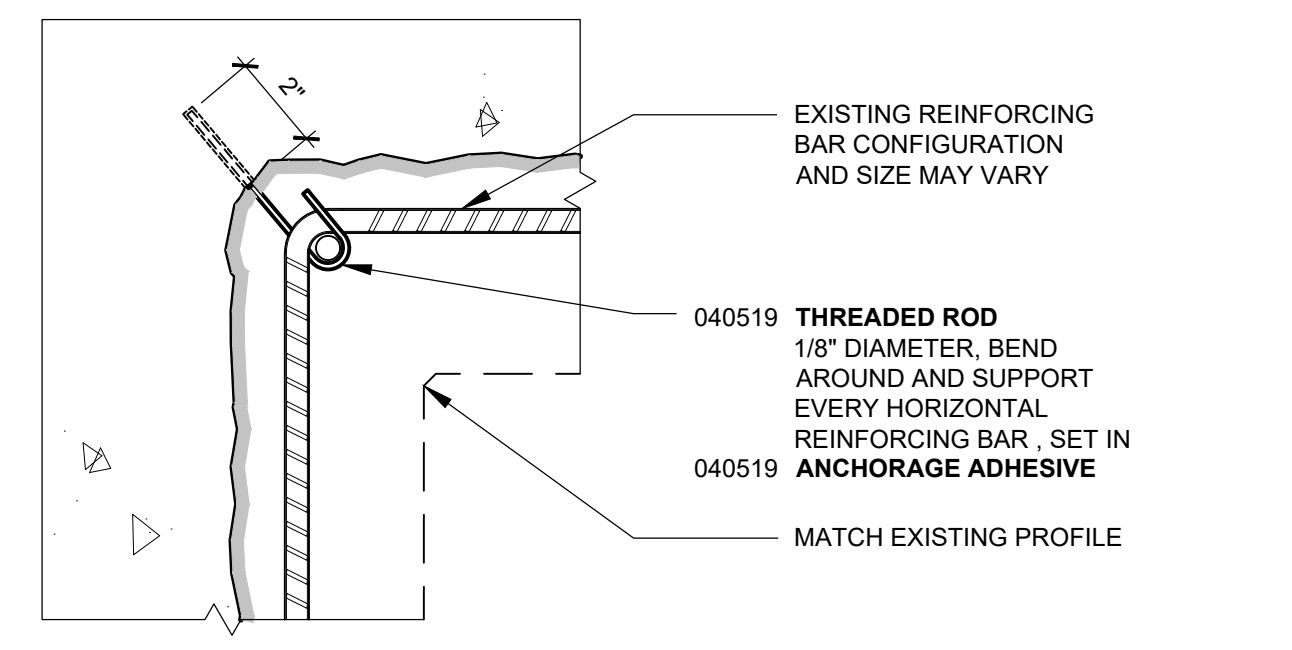

**INSIDE CORNER SECTION**

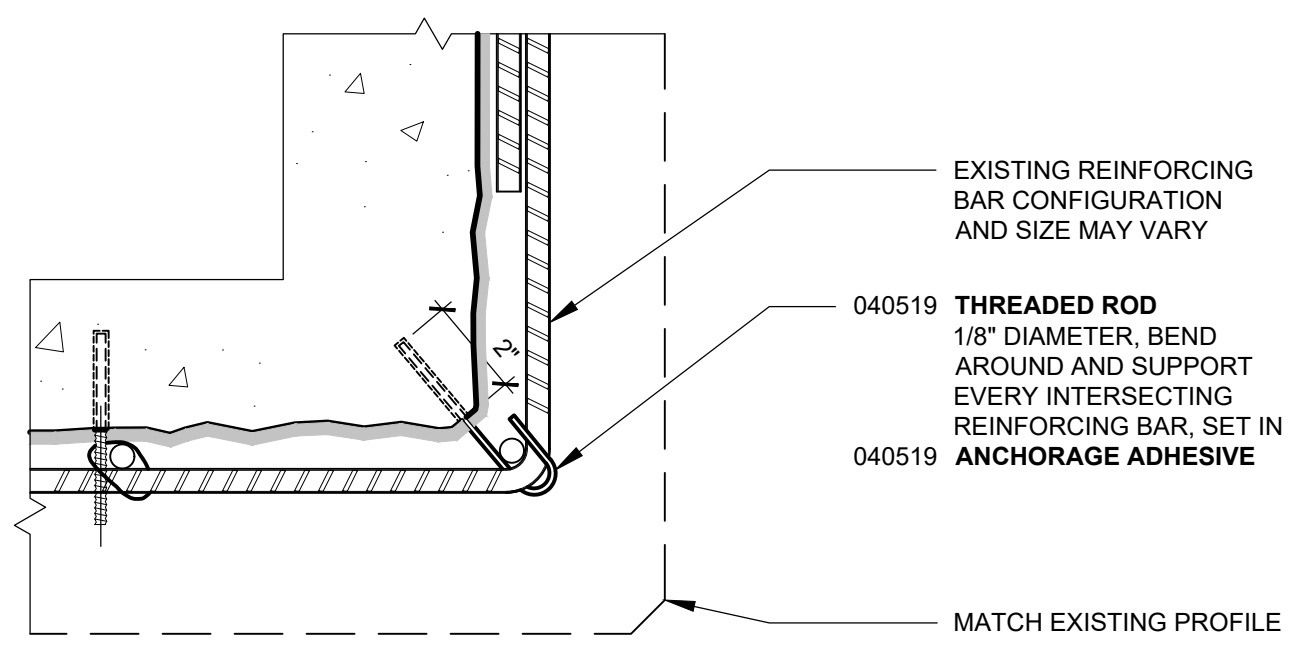


**OUTSIDE CORNER SECTION**

**@ CORNER**

NTS

**@ PARTIAL / NO REBAR EXPOSURE**

**NOTE: FOR ANY OPTION, NEW REINFORCING BAR CONCRETE COVER SHALL BE EQUAL OR GREATER THAN EXISTING REINFORCING BAR COVER.**

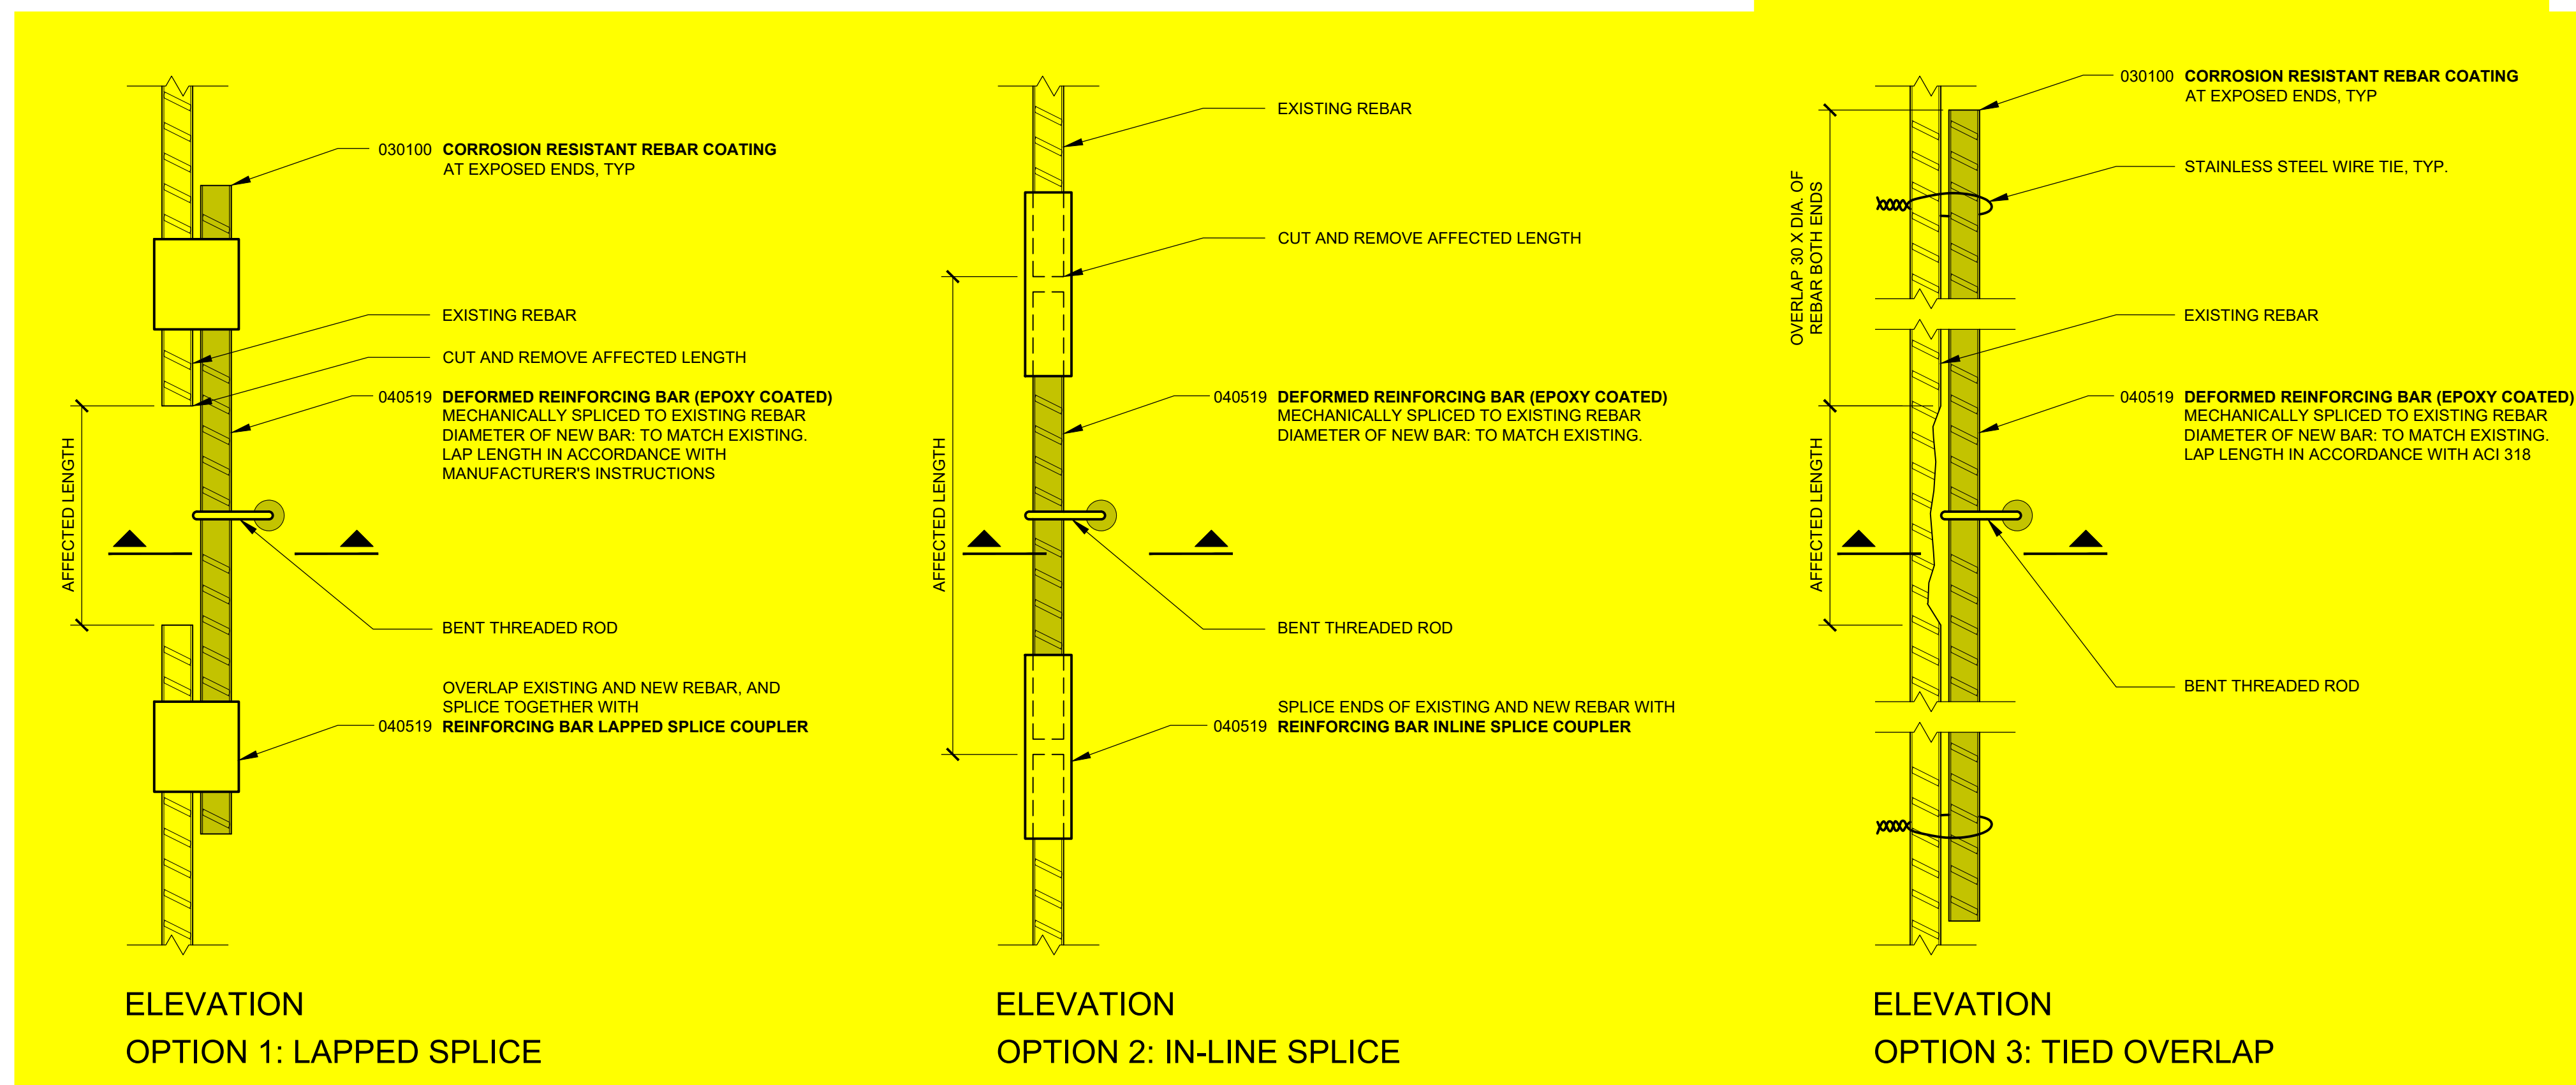

**@ CORRODED REBAR**

NTS

**CON 100 CONCRETE SPALL REPAIR: VERTICAL SURFACE (SF)**

2 OF 2